





Test Report

| Report nº: | ACU 470/1 | 12 | - | Data: _ | 2012-11-28 | _ |
|-----------------------|----------------------|-----------------|-------------------------|---------------|-------------------------|------------------------------|
| Requested by: | | | | | | |
| Name: | Amorim Cork Compos | iltes, S.A. | | | | |
| Adress: | Rua de Meladas, 260 | - Apartado 1; | 4536-902 N | lozelos VFR | | |
| Contact: | Fax: +351 2 | 12 557 601 | Phone: | +351 212 55 | 7 659 e-mail | ; jsilva.acc@amorim.com |
| Manufacturer and test | specimen identific | ation: | | | | |
| Name*: | Amorim Cork Compos | ites, S.A. | | | | |
| Test specimen*: | AcoustiCORK T66 | | | | | |
| | | | | | | |
| Test data: | | | | | | |
| Test: | Laboratory measureme | ent of the redu | ction of the | transmitted h | mpact noise by floor co | overings, △Lw (SACU.LAB.06) |
| Date of test: | | 2012 | -11-21 | Date | constr. test element: | 2012-12-21 |
| Source roor | n: | | | Rece | iving room: | |
| Temperatur | e (°C): | 16.3 ± 1 | | Temp | erature (°C): | 16.1 ± 1 |
| Relative Hui | midity (%): | 57.3 ± 5 | | Relat | ive Humidity (%): | 60.4 ± 5 |
| Static Press | ure (mbar): | 1016.6 ± | 5 | Statio | : Pressure (mbar): | 1016.5 ± 5 |
| Standards: | ISO 10140-1:2010; IS | O 10140-3:20 | 10; ISO 10 ⁻ | 140-4:2010; [| NP EN ISO 717-2:2009 | 9 |
| Operator(s): | José N | ascimento | | Report | author(s): José Nas | cimento / Paulo Amado Mendes |

Test specimen description and test opening:

Floor covering constituted by a linoleum layer with nominal thickness of 3,2mm (sample with our reference ACU339A/12), and an agglomerate of rubber and cork underlay with nominal thickness of 3,0mm (sample with your reference AcoustiCORK T66 and our reference ACU337A/12), over a reinforced concrete slab of thickness 14cm (ITeCons heavyweight standard floor). The total area of the test specimen is 3,56m x 3,56m, with a 20cm width of its perimeter supported on the test rim. The test opening is 3,16m x 3,16m, which corresponds to an area of approximately 10m2.



Test equipment:

Acoustic chambers at ITeCons (Source room: cubic shape with approximately 3,75 m edges and multi-layered "Viroc" walls about 50cm thick; receiving room: parallelepiped shape of 3,92 m x 3,92 m x 4,72 m and double layered reinforced concrete walls with masonry units about 50cm thick); "Bruel & Kjaer" Pulse multianalyser system, PUL02, model 3560-C-T46, with five acquisition channels; "Bruel & Kjaer" rotating microphone boom, type 3923, GIR03, with "Bruel & Kjaer" 1/2" microphone, type 4190, MIC08; sound level meter calibrator, type 4231, from "Bruel & Kjaer", CLS04; Impact sound generator, type 3207, from "Bruel & Kjaer", MPR02; ominidirectional sound source, type OMNIPOWER 4292, from "Bruel & Kjaer", FSO03; thermohygrometer THR09; barometer BAR01; thermometer, TER03-02.

Brief description of test procedure:

The test is performed in the laboratory, in accordance with the ISO 10140-3:2010 standard, by the following procedure: measurement of the sound pressure level in the receiving room, with the normalized tappling machine acting on the ITeCons standard floor (a reinforced concrete slab of thickness 140 mm); application of the covering on the reference floor, in accordance with the manufacturer's specification; evaluation of the sound pressure level in the receiving room, in 4 different positions of the normalized tapping machine; evaluation of the reverberation times in the receiving room, considering 1 source position and 2 decays measured, at least, at 3 microphone positions (Engineering method); calculation of the difference between those two sound pressure levels, for each band of frequency, being the result transposed to a normalized curve, corresponding to a reinforced concrete floor of thickness 140 mm. The normalized impact sound pressure level of the reference floor with floor covering under test is, then, determinated in accordance with the ISO 10140-3:2010 standard. The NP EN ISO 717-2:2009 standard is used for the calculation of the sound reduction index DLw, applying the method of calculating the normalized impact sound pressure level index to the initial reference floor curve and to the reference floor affected by the difference previously calculated.

Notes: The present report cannot be reproduced, except in full, without the written agreement of ITeCons.

The results are valid exclusively for the tested specimens.

Data reported with * supplied by customer.











Calculations for the determination of the weighted impact sound pressure level reduction index of the covering under test, on a normalized floor:

Average sound pressure level in the receiving room, with covering (L2):

| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
|------------|------|------|------|------|------|------|------|------|------|
| L2 (dB) | 56.9 | 66.1 | 72.0 | 72.7 | 70.2 | 70.7 | 70.5 | 69.0 | 66.1 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L2 (dB) | 61.7 | 61.0 | 57.5 | 49.0 | 36.6 | 28.6 | 18.6 | 14.6 | 14.6 |

Average background noise pressure level in the receiving room (L0):

| | | | | | <u> </u> | <u> </u> | | | |
|------------|------|------|------|------|----------|----------|------|------|------|
| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
| L0 (dB) | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L0 (dB) | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 | 14.6 |

Average sound pressure level in the receiving room after background noise correction (L):

| | | | | <u> </u> | | | | • | |
|------------|------|------|------|----------|------|------|------|------|------|
| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
| L (dB) | 56.9 | 66.1 | 72.0 | 72.7 | 70.2 | 70.7 | 70.5 | 69.0 | 66.1 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L (dB) | 61.7 | 61.0 | 57.5 | 49.0 | 36.6 | 28.5 | 17.3 | 13.3 | 13.3 |

Average reverberation time in the receiving room (Tr):

| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
|------------|------|------|------|------|------|------|------|------|------|
| Tr (s) | 2.51 | 2.20 | 1.93 | 1.77 | 1.42 | 1.18 | 1.19 | 1.06 | 1.05 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| Tr (s) | 1.03 | 1.06 | 1.19 | 1.17 | 1.18 | 1.10 | 1.05 | 0.97 | 0.89 |

ACU 470/12

Notes: The present report cannot be reproduced, except in full, without the written agreement of ITeCons.

The results are valid exclusively for the tested specimens.

page 2/4











Results obtained from the test:

Normalized impact sound pressure level in the receiving room, of the ITeCons reference floor without the floor covering (Ln.0):

| | | 3 (2.1.) | <i>י</i> | | | | | | |
|-----------------------|------|----------|----------|------|------|------|------|------|------|
| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
| L _{n,e} (dB) | 54.4 | 64.3 | 70.7 | 70.1 | 73.1 | 76.7 | 75.7 | 75.8 | 76.1 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L _{n,f} (dB) | 78.4 | 77.1 | 77.2 | 76.9 | 76.7 | 76.8 | 75.6 | 73.5 | 70.8 |

Normalized impact sound pressure level in the receiving room, of the ITeCons reference floor with the floor covering (Ln):

| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
|---------------------|------|------|------|------|------|------|------|------|------|
| L _n (dB) | 53.7 | 63.5 | 70.0 | 71.0 | 69.5 | 70.8 | 70.6 | 69.6 | 66.7 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L _n (dB) | 62.4 | 61.5 | 57.5 | 49.1 | 36.7 | 28.8 | 17.9 | 14.2 | 14.6 |

Reduction of impact sound pressure level in the receiving room, resulting from the application of the floor covering ($\Delta L = Ln.0 - Ln$):

| | | 9 () | | | | | | | |
|------------|-----|-------|------|------|------|------|-------|-------|-------|
| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
| ΔL (dB) | 0.7 | 0.8 | 0.7 | -0.9 | 3.6 | 5.9 | 5.1 | 6.2 | 9.4 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| ΔL (dB) | 16 | 15.6 | 19.7 | 27.8 | 40 | 48 | >57.7 | >59.3 | >56.2 |

Standard/reference floor without floor covering (NP EN ISO 717-2:2009):

Normalized impact sound pressure level of the ITeCons reference floor (Ln,r,0):

| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
|-------------------------|------|------|------|------|------|------|------|------|------|
| L _{n,c,0} (dB) | 67.0 | 67.5 | 68.0 | 68.5 | 69.0 | 69.5 | 70.0 | 70.5 | 71.0 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L _{o.r.0} (dB) | 71.5 | 72.0 | 72.0 | 72.0 | 72.0 | 72.0 | 72.0 | 72.0 | 72.0 |

Notes: The present report cannot be reproduced, except in full, without the written agreement of ITeCons.

The results are valid exclusively for the tested specimens.

page 3/4









UNIVERSIDADE DE COIMBRA

Volume of the rooms (in m³):


Source room:

Receiving room: 75.3

Normalized impact sound pressure level of the reference floor with the floor covering under test (Ln,r):

| Freq. (Hz) | 100 | 125 | 160 | 200 | 250 | 315 | 400 | 500 | 630 |
|-----------------------|------|------|------|------|------|------|--------|--------|--------|
| L _{n,r} (dB) | 66.3 | 66.7 | 67.3 | 69.4 | 65.4 | 63.6 | 64.9 | 64.3 | 61.6 |
| Freq. (Hz) | 800 | 1000 | 1250 | 1600 | 2000 | 2500 | 3150 | 4000 | 5000 |
| L _{n,r} (dB) | 55.5 | 56.4 | 52.3 | 44.2 | 32 | 24 | =<14.3 | =<12.7 | =<15.8 |

The values indicated with "=<" represent measurement limit for which the difference between the sound pressure level in the receiving room, resulting from the normalized tapping machine, and the background noise is less than 6dB.

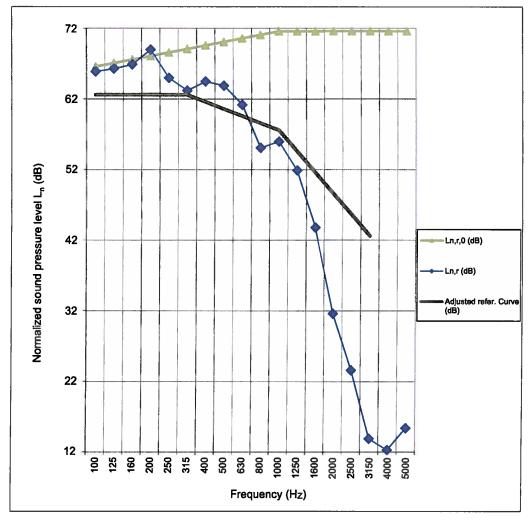

 $L_{n,r,0,w}(C_{l,r,0}) = 78 (-11)$ dB

 $L_{n,r,w}(C_{l,r}) = 61(0)$ dB $\Delta L_w(C_{I,\Delta}) = 17 (-11) dB$

(Results obtained in accordance with NP EN ISO 717-2:2009)


Technical responsability:

(Paulo Amado Mendes, Technical and Scientific Superviser)

Administration:

Notes: The present report cannot be reproduced, except in full, without the written agreement of ITeCons The results are valid exclusively for the tested specimens.

page 4/4

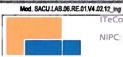

ACU 470/12